

TECH BULLETIN

TEK-B13

Nissan Clutch Bleeding Procedures

Nissan 240SX, 300ZX, Maxima and Pick Ups

Clutch Kits: 06-032, 06-038, 06-038-P1, 06-038-P2, 06-042, 06-042-P1, 06-042-P2, 06-059, 06-061, 06-062, 06-075, 06-076.

Most clutch master cylinders are pointing down and will trap air in back of the cylinder bore. To properly bleed the system you will have to raise the front of the vehicle using a suitable lift. Some vehicles have two bleeders, one located at the slave cylinder and one located near the frame rail in the clutch hard line. The exception to the above is the 300ZX where the bleeder screw is located behind the right passenger side headlight.

It might be necessary before bleeding to flush out the clutch hydraulic fluid to remove all the contaminated old fluid. You will need to alternately bleed through both bleeder screws until all of the air is out of the system.